

MTL-TR 87-50

AD

AD-A188 733

DTIC FILE COPY

HYDROGEN INDUCED CRACKS IN ARMOR STEEL WELDMENTS FABRICATED WITH AUSTENITIC FILLER ALLOYS

WILLIAM S. RICCI


PROCESSING TECHNOLOGY DIVISION

September 1987

Approved for public release; distribution unlimited.



**US ARMY
LABORATORY COMMAND
MATERIALS TECHNOLOGY
LABORATORY**

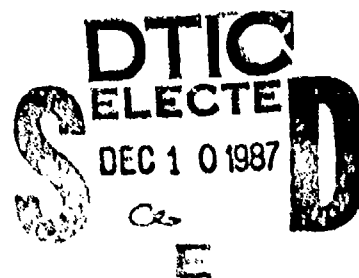

**U.S. ARMY MATERIALS TECHNOLOGY LABORATORY
Watertown, Massachusetts 02172-0001**

02172-0001

UNCLASSIFIED

SECURITY CLASSIFICATION OF THIS PAGE (When Data Entered)

A188 733

REPORT DOCUMENTATION PAGE		READ INSTRUCTIONS BEFORE COMPLETING FORM
1. REPORT NUMBER MTL TR 87-50	2. GOVT ACCESSION NO.	3. RECIPIENT'S CATALOG NUMBER
4. TITLE (and Subtitle) HYDROGEN INDUCED CRACKS IN ARMOR STEEL WELDMENTS FABRICATED WITH AUSTENITIC FILLER ALLOYS		5. TYPE OF REPORT & PERIOD COVERED Final Report
7. AUTHOR(s) William S. Ricci		6. PERFORMING ORG. REPORT NUMBER
9. PERFORMING ORGANIZATION NAME AND ADDRESS U.S. Army Materials Technology Laboratory Watertown, Massachusetts 02172-0001 SLCMT-MCD		8. CONTRACT OR GRANT NUMBER(s)
11. CONTROLLING OFFICE NAME AND ADDRESS U.S. Army Laboratory Command 2800 Powder Mill Road Adelphi, Maryland 20783-1145		10. PROGRAM ELEMENT, PROJECT, TASK AREA & WORK UNIT NUMBERS D/A Project: 1L263102D077 Agency Accession: DA 30 3398
14. MONITORING AGENCY NAME & ADDRESS (if different from Controlling Office)		12. REPORT DATE September 1987
		13. NUMBER OF PAGES 11
		15. SECURITY CLASS. (of this report) Unclassified
		15a. DECLASSIFICATION/DOWNGRADING SCHEDULE
16. DISTRIBUTION STATEMENT (of this Report) Approved for public release; distribution unlimited.		
17. DISTRIBUTION STATEMENT (of the abstract entered in Block 20, if different from Report)		
18. SUPPLEMENTARY NOTES		
19. KEY WORDS (Continue on reverse side if necessary and identify by block number) Welding, Cracking Armor, Stainless steel, Hydrogen,		
20. ABSTRACT (Continue on reverse side if necessary and identify by block number) (SEE REVERSE SIDE)		

Block No. 20
↓

ABSTRACT

Hydrogen induced cracks have been identified in the weld metal of cast armor steel weldments fabricated with austenitic electrodes. Cracks propagated through a well defined band of martensite located between the fusion boundary and the composite region of the weld metal. Martensite band formation was found to result from the combined effects of vigorous hydrodynamic forces, especially in large molten weld pools, and the interdiffusion of alloying elements in that system formed between the base metal and the weld metal. Methods of controlling this form of cracking include limiting base metal dilution, minimizing the concentration of available hydrogen in the welding arc atmosphere, or the selection of more suitable ferritic filler alloys.

(Keywords:)

Accession For	
NTIS GRA&I	<input checked="" type="checkbox"/>
DTIC TAB	<input type="checkbox"/>
Unannounced	<input type="checkbox"/>
Justification	
By	
Distribution/	
Availability Codes	
Dist	Avail and/or Special
A-1	



BACKGROUND

The work reported here was performed as part of a failure analysis of M60 tank tow lug weldments and was sponsored by the Program Manager-M60 tanks.

INTRODUCTION

Austenitic filler materials are often used to join high hardenability armor steels. The main reason for their selection over ferritic filler alloys has traditionally been that they provide a deterrent to hydrogen induced cracking (HIC) in applications where preheat or post weld heat treatment would be impractical or cost prohibitive or when excessive arc atmosphere contamination would be unavoidable. Examples of such applications include the field repair or appurtenance welding of thick walled ballistic structures.

Austenitic weld metals have a higher solubility for hydrogen than ferritic weld metals or heat affected zones (HAZs). Hydrogen in crack sensitive martensitic HAZs is, therefore, able to escape at a faster rate than it is replenished by hydrogen from austenitic weld deposits. This results in a lower hydrogen concentration in martensitic HAZs, and this reduces the tendency to initiate HIC.

The lower yield strengths of austenitic filler alloys is also believed to contribute to their reduced tendency to form hydrogen induced cracks. This is mainly due to the relief of HAZ residual stresses that result from localized plastic deformation in the weld metal.^{1,2}

Typically, cracks in armor weldments fabricated with austenitic electrodes are found in the weld metal oriented transverse to the weld axis. Similarly, hydrogen induced cracks in armor weldments fabricated with ferritic filler materials are typically found in the HAZ parallel to the weld axis, Figure 1.^{*} Cracks in armor weldments fabricated with austenitic electrodes, located in the weld metal but oriented parallel to the weld axis and away from the weld centerline, have not, however, been previously documented.

The occurrence of hydrogen induced cracks in the intermediate zone of armor steel weldments fabricated with austenitic electrodes will be discussed in this report. The term "intermediate zone" refers to parts of the composite region of the weld as well as the partially melted zone, the unmixed zone, and the weld interface, as defined by Baeslack et al.³ (Figure 2).

EXPERIMENTAL

Shielded metal arc welded appurtenances, fabricated with type 307 austenitic stainless steel electrodes, were removed from M60 tank hulls. The chemical compositions of the weld metal and base metal are shown in Table 1. The composition of the base metal was consistent with that of cast armor steel (MIL-A-11356).

*RICCI, W.S. Unpublished research, 1983.

1. CASTRO, R., and de CADENET, J.J. *Welding Metallurgy of Stainless and Heat Resisting Steels*. Cambridge University Press, Great Britain, 1975.

2. *Effective Use of Weld Metal Yield Strength for HY Steels*. Committee on Effective Utilization of Weld Metal Yield Strength, NMAN Report No. 380, January 1983.

3. BAESLACK, W.A., LIPPOLD, T.C., and SAVAGE, W.F. *Unmixed Zone Formation in Austenitic Stainless Steel Weldments*. *Welding Journal*, v. 58, no. 6, June 1979.

Table 1. CHEMICAL COMPOSITIONS OF WELD METAL AND BASE METAL

	C	Mn	Si	Cr	Ni	Mo	S	P
Weld Metal	0.1	3.9	0.4	20.0	9.5	0.9	0.03	0.026
Base Metal	0.25	1.16	0.53	1.02	1.01	0.42	0.019	0.016

All welds were inspected for cracks by visual and liquid penetrant techniques. Cracks were sectioned and prepared for metallographic examination. A 50% glycerine, 30% hydrochloric acid, 20% nitric acid etchant was used to define both weld metal and HAZ microstructures. Hardness traverses were taken from polished and etched specimens. Fracture surfaces were examined in an SEM.

RESULTS

Metallography revealed cracks located in the weld metal adjacent to the fusion boundary on both sides of welded joints. Figure 3 shows one such crack. All cracks propagated through a continuous band of martensite at or adjacent to the fusion boundary (Figures 4 and 5). This martensite band ranged in width from 10-140 μm , and in some locations was completely divorced from the fusion boundary by a thin layer of austenitic weld metal (Figure 5). No cracks were found in areas where this band was discontinuous or nonexistent (Figures 6 and 7).

A hardness traverse was taken across weld fusion boundaries. Knoop hardness data were taken through the weld metal, the fusion boundary, the HAZ, and into the unaffected base metal. This data is presented in Figure 8. The martensitic phase through which the cracks propagated had a hardness of approximately 420 KHN, which is significantly higher than that of the weld metal (225 KHN), HAZ (320 KHN) and unaffected base metal (280 KHN).

SEM examination of the fractured surface revealed a mixed mode, intergranular-transgranular fracture path. This is characteristic of hydrogen induced cracks that propagate at low stress intensity levels.

DISCUSSION

The hydrogen induced cracks observed resulted from the presence of a susceptible microstructure (i.e., martensite) in a "hydrogen charged reservoir" (austenite). This cracking phenomenon has not been widely documented in the open literature.

Several investigators^{4,5} have studied the formation of martensite at the weld fusion boundary. This martensite formation is believed to be due to the interdiffusion of alloying elements in that system between the base metal and the weld metal. Kinetics alone, however, fall short of explaining martensite formations in bands adjacent to, but divorced from, the fusion boundary (Figure 5). Figure 9 shows an example of a martensite band extending a relatively large distance into the weld metal along the fusion boundary of successive weld passes. A more complete

4. ORNATH, F., SOUNDY, J., WEISS, D.Z., and MINKOFF, I. *Weld Pool Segregation During the Welding of Low Alloy Steels With Austenitic Electrodes*. *Welding Journal*, v. 60, no. 11, November 1981.

5. LANCASTER, J.F. *Metallurgy of Welding*. George Allen and Unwin, London, 1960.

explanation for the observed martensite band formation is that, in addition to kinetics, hydrodynamic forces play a major role. These forces are sufficient, especially in large molten weld pools, to physically wash away part of the fusion zone and introduce it into the composite region of the weld metal.

The Schaeffler diagram (Figure 10) can provide a first approximation of the effect of base metal dilution on martensite formation. For the alloy systems of interest here, only 17% dilution of the filler alloy with the base metal will result in the formation of martensite. It should be recognized that 40% dilution is often encountered under ordinary welding conditions, especially in the root pass. One alternative in resolving this problem, therefore, would be the use of higher alloy filler metals such as 309, 310 or 312 that can tolerate more dilution because of their more stable duplex austenite-ferrite structure. For example, 312 weld metals can tolerate approximately 45% dilution without forming martensite. The use of these alloys in other than high dilution passes (such as the root and buttering passes) is not recommended, however, since high ferrite contents reduce the ductility of the duplex structure.

The elimination of martensite is not the only method of deterring HIC in austenitic weld deposits. It is often more economical to reduce HIC susceptibility by reducing the available hydrogen concentration in the welding arc. This reduction can usually be attained by using electrodes with low moisture contents, and is generally considered to be the preferred alternative.

CONCLUSIONS

1. Hydrogen induced cracks have been identified in armor steel weldments fabricated with austenitic electrodes.
2. Hydrogen induced cracks may form in a well defined band of martensite located between the fusion boundary and the composite region of the weld metal.
3. Martensite band formation is due to the combined effects of vigorous hydrodynamic forces, especially in large molten weld pools, and the interdiffusion of alloying elements in that system formed between the base metal and the weld metal.
4. Cracking can be effectively controlled by limiting base metal dilution and minimizing the concentration of available hydrogen in the welding arc.
5. The use of higher alloy filler materials is recommended for critical applications, especially in the root pass.
6. More economical ferritic filler alloys should be used whenever low hydrogen conditions can be properly maintained.

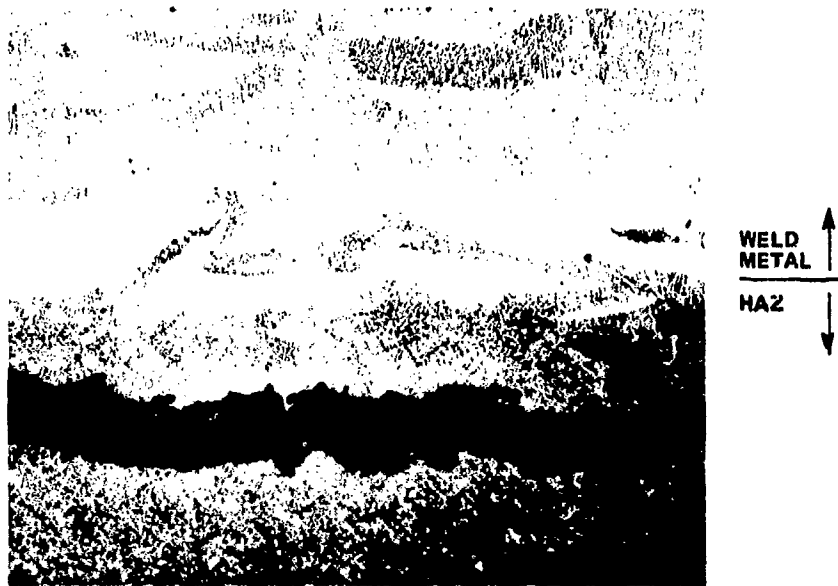


Figure 1. Hydrogen induced crack located in the HAZ of an armor steel weldment (150X).

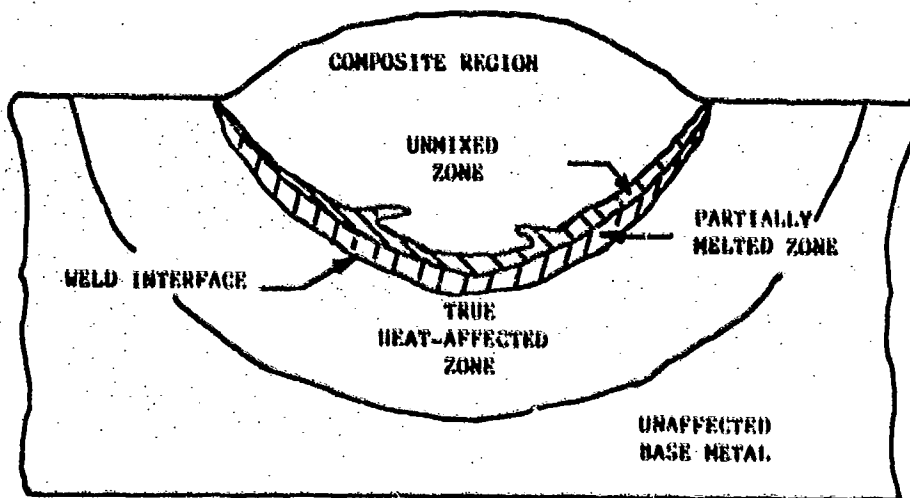


Figure 2. Schematic illustration showing the regions of a heterogeneous weld.

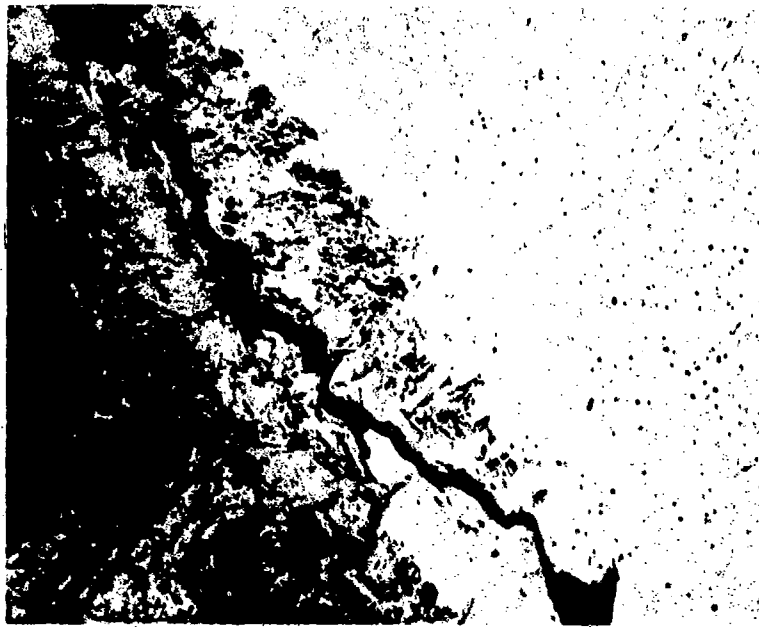


Figure 3. Crack in weld metal adjacent to fusion boundary (37.5X).

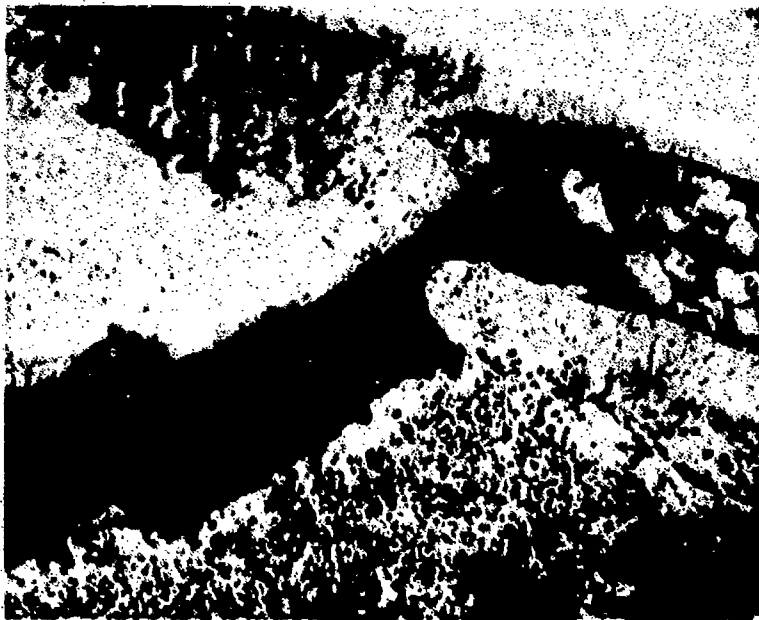


Figure 4. Crack propagating through a continuous band of martensite in weld metal along fusion boundary (375X). Crack deviation was due to multipass welding conditions.



Figure 5. Crack in martensite band separated from fusion boundary by a thin layer of austenite (375X).

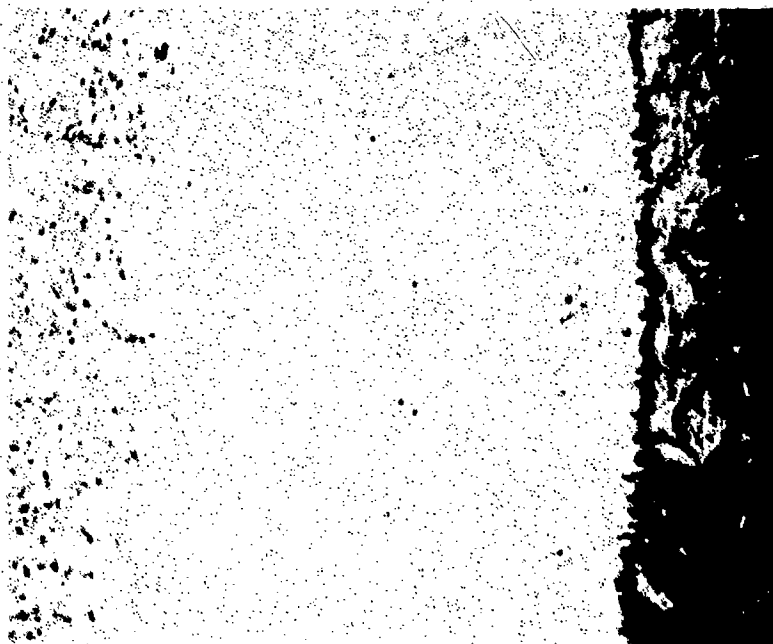


Figure 6. Discontinuous band of martensite adjacent to the fusion boundary (375X).



Figure 7. Reduced levels of dilution resulted in martensite-free fusion boundaries (375X).

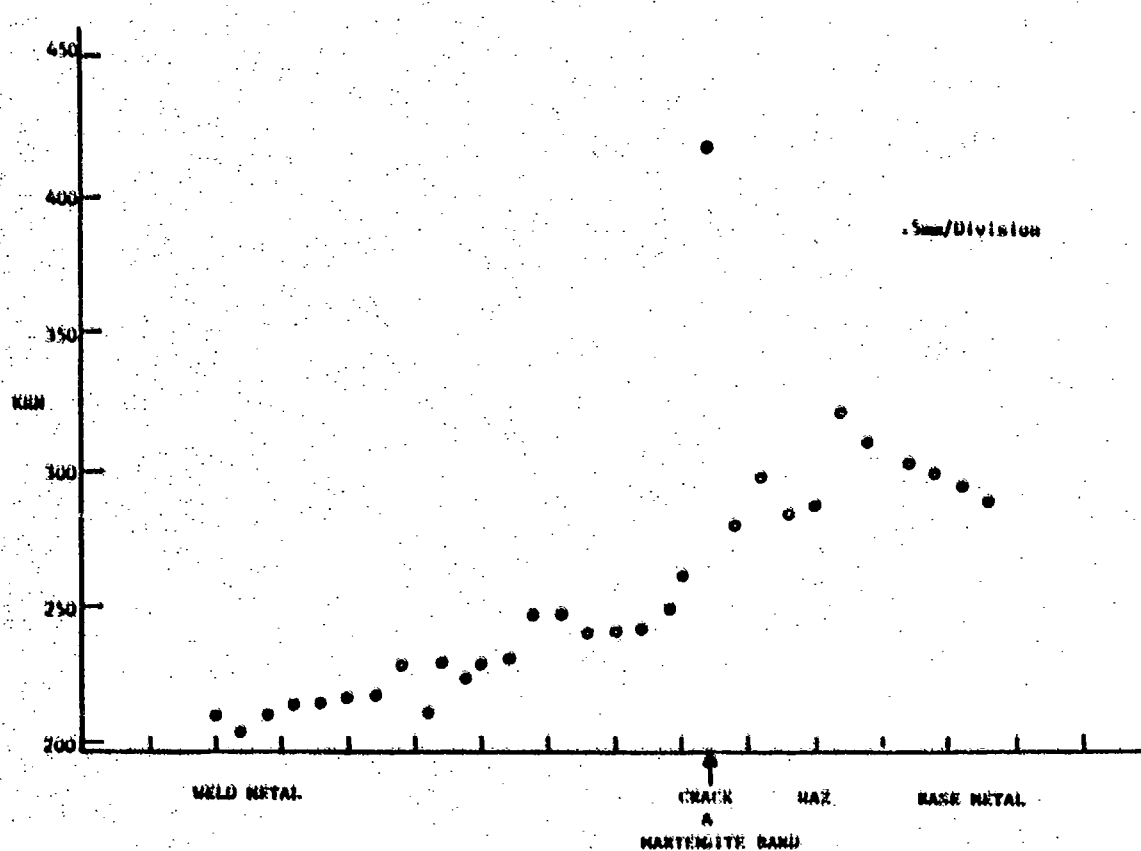


Figure 8. Hardness traverse taken across the weld fusion boundary.

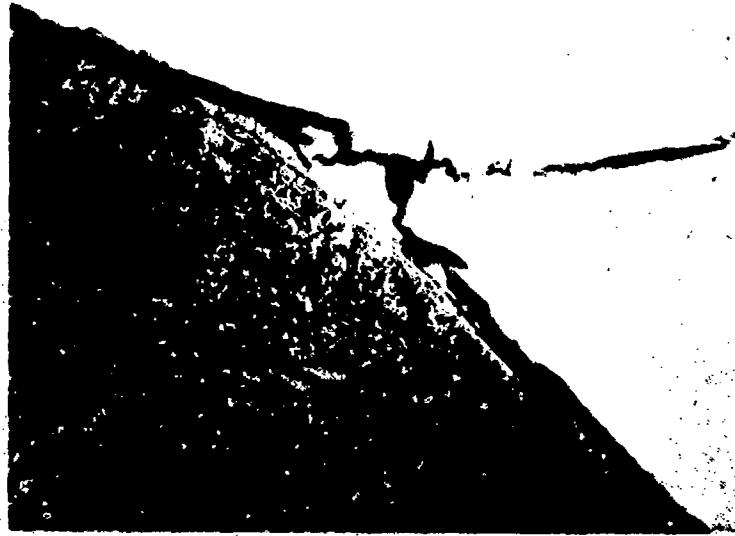


Figure 9. Martensite band extending along fusion boundary of successive weld passes (37.5X).

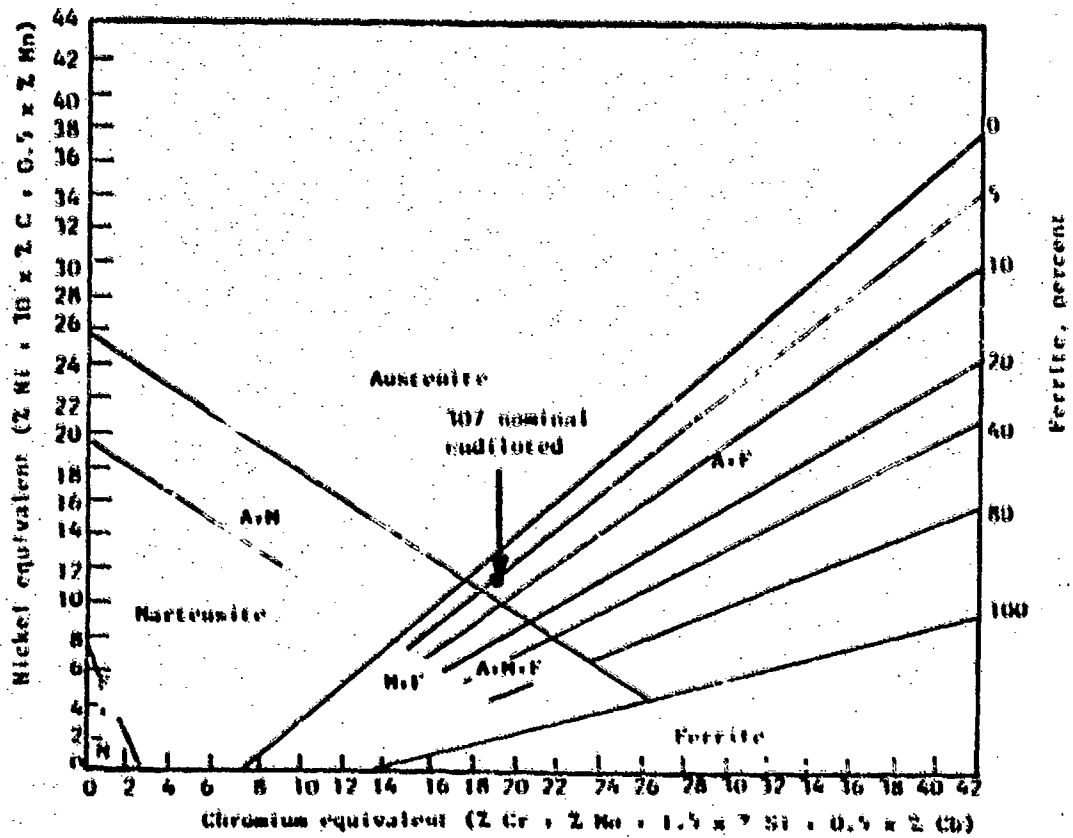


Figure 10. Schaeffler diagram for estimating the microstructure of stainless steel weld metal.

DISTRIBUTION LIST

No. of Copies	To
1	Office of the Under Secretary of Defense for Research and Engineering, The Pentagon, Washington, DC 20301
	Commander, U.S. Army Laboratory Command, 2800 Powder Mill Road, Adelphi, MD 20783-1197
1	ATTN: Technical Library
	Commander, Defense Technical Information Center, Cameron Station, Building 5, 5010 Duke Street, Alexandria, VA 22304-6145
2	ATTN: DTIC-FDAC
	Metals and Ceramics Information Center, Battelle Columbus Laboratories, 505 King Avenue, Columbus, OH 43201
1	ATTN: Mr. Robert J. Fiorentino, Program Manager
1	Defense Advanced Research Projects Agency, Defense Sciences Office/MSD, 1400 Wilson Boulevard, Arlington, VA 22209
	Headquarters, Department of the Army, Washington, DC 20314
1	ATTN: DAEN-RDN, Mr. J. J. Healy
	Commander, U.S. Air Force Wright Aeronautical Laboratories, Wright-Patterson Air Force Base, OH 45433
1	ATTN: AFWAL/MLC
1	AFWAL/MLLP, D. M. Forney, Jr.
1	AFWAL/MLBC, Mr. Stanley Schulman
1	AFWAL/MLLS, Dr. Terence M. F. Ronald
1	AFWAL/FIBEC, Dr. Steve Johnson
1	Edward J. Morrissey, AFWAL/MLTE, Wright-Patterson Air Force Base, OH 45433
	Commander, Army Research Office, P.O. Box 12211, Research Triangle Park, NC 27709-2211
1	ATTN: Information Processing Office
1	Dr. George Mayer
	Commander, U.S. Army Materiel Command, 5001 Eisenhower Avenue, Alexandria, VA 22333
1	ATTN: AMCLD
	Commander, U.S. Army Armament, Munitions and Chemical Command, Dover, NJ 07801
1	ATTN: Mr. Harry E. Pably, Jr., PLASTEC, Director
	Commander, U.S. Army Aviation Systems Command, 4300 Goodfellow Blvd., St. Louis, MO 63120
1	ATTN: ANDAV-NS, Harold Law
	Director, U.S. Army Ballistic Research Laboratory, Aberdeen Proving Ground, MD 21005
1	ATTN: ANDAR-TSB-S (STINFO)
	Commander, U.S. Army Electronics Research and Development Command, Fort Monmouth, NJ 07703
1	ATTN: AMOSD-L
1	AMOSD-E
	Commander, U.S. Army Foreign Science and Technology Center, 220 7th Street, N.E., Charlottesville, VA 22901
1	ATTN: Military Tech
	Commander, U.S. Army Materiel Systems Analysis Activity, Aberdeen Proving Ground, MD 21005
1	ATTN: AMASY-MP, H. Cohen
	Commander, U.S. Army Missile Command, Redstone Scientific Information Center, Redstone Arsenal, AL 35898-5241
1	ATTN: AMSNI-RD-ES-R/ILL Open Lit
1	AMSNI-RLH
1	AMSNI-RLA, Dr. James J. Richardson

No. of Copies	To
	Commander, U.S. Army Belvoir Research, Development and Engineering Center, Fort Belvoir, VA 22060-5606
1	ATTN: STRBE-D
1	STRBE-G
1	STRBE-N
1	STRBE-VL
	Commander, U.S. Army Aviation Applied Technology Directorate, Aviation Research and Technology Activity (AVSCOM), Fort Eustis, VA 23604-5577
1	ATTN: SAVRT-TY-ATP, Mr. James Gomez, Aerospace Engineer
	Commander, U.S. Army Tank-Automotive Command, Warren, MI 48090
1	ATTN: AMSTA-RCKM
	Director, Benet Weapons Laboratory, LCWSL, USA AMCOM, Watervliet, NY 12189
1	ATTN: AMSMC-LCB-TL
1	AMSMC-LCB-PS, Dr. I. Ahmad
	David Taylor Naval Ship Research and Development Center, Annapolis, MD 21402
1	ATTN: Dr. Michael Vassilaros - Code 2814
	Office of Naval Technology, 800 N. Quincy Street, Arlington, VA 20017
1	ATTN: Mr. J. J. Kelly - Code MAT 0715
	Naval Research Laboratory, Washington, DC 20375
1	ATTN: Code 5830
1	Dr. G. R. Yoder - Code 6384
1	Dr. S. C. Sanday - Code 6370
	Chief of Naval Research, Arlington, VA 22217
1	ATTN: Code 471
1	Dr. Steven G. Fishman
	Naval Sea Systems Command, Washington, DC 20362
1	ATTN: Mr. Marlin Kinna - 62R4
	Naval Air Development Center, Warminster, PA 18974
1	ATTN: Dr. E. U. Lee - Code 60632
	Naval Surface Weapons Center, White Oak, Silver Spring, MD 20910
1	ATTN: John V. Foltz - Code R32
1	Dr. Herbert Newborn - Code R34
	National Aeronautics and Space Administration, Washington, DC 20546
1	ATTN: Mr. Michael A. Greenfield, Program Manager for Materials, Code RTM-6
	National Aeronautics and Space Administration, Lewis Research Center, Cleveland, OH 44135
1	ATTN: Dr. James A. DiCarlo, Mail Stop 106-1
	National Aeronautics and Space Administration, Marshall Space Flight Center, Huntsville, AL 35812
1	ATTN: R. J. Schwinghammer, EH01, Dir, M&P Lab
1	Mr. W. A. Wilson, EH41, Bldg. 4612
	The Boeing Vertol Company, P.O. Box 16858, Philadelphia, PA 19142
1	ATTN: Mr. Robert L. Pinckney, Mail Stop P62-06
1	Mr. Joseph W. Lenski, Jr., Mail Stop P32-09
	E. I. DuPont De Nemours and Company, Inc., Textile Fibers Department, Pioneering Research Laboratory, Experimental Station, Wilmington, DE 19898
1	ATTN: Blake R. Bichmeir
1	Joyce W. Widrig
	Mr. Rex C. Claridge, TRW, Incorporated, Manufacturing Division, Mail Stop 01-2210, 1 Space Park, Redondo Beach, CA 90278
1	Dr. James A. Cornie, Materials Processing Center, Bldg. 8, Room 237, Massachusetts Institute of Technology, 77 Massachusetts Avenue, Cambridge, MA 01239

No. of
Copies

To

-
- 1 Dr. Bhagwan K. Das, Engineering Technology Supervisor, The Boeing Company,
P.O. Box 3999, Seattle, WA 98124
- 1 Leroy Davis, NETCO, 2225 East 28th Street, Building 5, Long Beach, CA 90806
- 1 Mr. Joseph F. Dolowy, Jr., President, DWA Composite Specialties, Inc.,
21133 Superior Street, Chatsworth, CA 91311
- 1 Mr. Robert E. Fisher, President, AMERCOM, Inc., 8948 Fullbright Avenue,
Chatsworth, CA 91311
- 1 Mr. Louis A. Gonzalez, Kaman Tempo, 816 State Street, Santa Barbara, CA 93101
- 1 Prof. James G. Goree, Dept. of Mechanical Engineering, Clemson University,
Clemson, SC 29631
- 1 William F. Grant, AVCO Specialty Materials Division, 2 Industrial Avenue,
Lowell, MA 01851
- 1 Mr. Jacob Gubbay, Charles Stark Draper Laboratories, 555 Technology Square,
Mail Station 27, Cambridge, MA 02139
- 1 Mr. John E. Hack, Southwest Research Institute, 6220 Culebra Road,
San Antonio, TX 78284
- 1 Dr. H. A. Katzman, The Aerospace Corporation, P.O. Box 92957
Los Angeles, CA 90009
- Lockheed California Company, Burbank, CA 91520
- 1 ATTN: Mr. Rod F. Simenz, Department of Materials and Processes
- Lockheed Georgia Company, 86 South Cobb Drive, Marietta, GA 30063
- 1 ATTN: Materials and Processes Engineering Department
- 1 Mr. James Carroll
- Material Concepts, Inc., 2747 Harrison Road, Columbus, OH 43204
- 1 ATTN: Mr. Stan J. Paprocki
- 1 Mr. David Goddard
- 1 Dr. Mohan S. Misra, Martin Marietta Aerospace, P.O. Box 179, Denver, CO 80201
- 1 Mr. Patrick J. Moore, Staff Engineer, Lockheed Missiles and Space Company,
Organization 62-60, Building 104, P.O. Box 504, Sunnyvale, CA 94086
- 1 R. Byron Pipes, Professor & Director, Center for Composite Materials,
University of Delaware, Newark, DE 19711
- 1 Dr. Karl M. Prewé, Principal Scientist, United Technologies Research Center,
Mail Stop 24, East Hartford, CT 06108
- 1 Dr. B. W. Rosen, Materials Sciences Corporation, Gwynedd Plaza 11, Bethlehem
Pike, Spring House, PA 19477
- 1 Prof. Marc H. Richman, Division of Engineering, Brown University,
Providence, RI 02912
- 1 Mr. Ronald P. Tye, Energy Materials Testing Laboratory, Biddeford Industrial
Park, Biddeford, ME 04005
- 1 Mr. Robert C. Van Sieten, Vought Corporation, Advanced Technology Center,
P.O. Box 226144, Dallas, TX 75266
- 1 Prof. Franklin E. Wawner, Department of Materials Science, School of Engineering
and Applied Sciences, University of Virginia, Charlottesville, VA 22903
- 1 Dr. Carl Zweben, General Electric Company, Valley Forge Space Center/H4018,
P.O. Box 8555, Philadelphia, PA 19101
- Director, U.S. Army Materials Technology Laboratory, Watertown, MA 02172-0001
- 2 ATTN: SLCHT-IML
- 1 Author

U.S. Army Materials Technology Laboratory
Watertown, Massachusetts 02172-0001
HYDROGEN INDUCED CRACKS IN ARMOR STEEL WELDMENTS
FABRICATED WITH AUSTENITIC FILLER ALLOYS -
William S. Ricci

AD

UNCLASSIFIED
UNLIMITED DISTRIBUTION

Key Words

Welding
Armor
Stainless steel

Technical Report MTL TR 87-50, September 1987, 11 pp -
illus-table, D/A Project 11263102D0077,
Agency Accession DA 30 3398

Hydrogen induced cracks have been identified in the weld metal of cast armor steel weldments fabricated with austenitic electrodes. Cracks propagated through a well defined band of martensite located between the fusion boundary and the composite region of the weld metal. Martensite band formation was found to result from the combined effects of vigorous hydrodynamic forces, especially in large molten weld pools, and the interdusion of alloying elements in that system formed between the base metal and the weld metal. Methods of controlling this form of cracking include limiting base metal dilution, minimizing the concentration of available hydrogen in the weld metal, and atmosphere, or the selection of more suitable ferritic filler alloys.

U.S. Army Materials Technology Laboratory
Watertown, Massachusetts 02172-0001
HYDROGEN INDUCED CRACKS IN ARMOR STEEL WELDMENTS
FABRICATED WITH AUSTENITIC FILLER ALLOYS -
William S. Ricci

AD

UNCLASSIFIED
UNLIMITED DISTRIBUTION

Key Words

Welding
Armor
Stainless steel

Technical Report MTL TR 87-50, September 1987, 11 pp -
illus-table, D/A Project 11263102D0077,
Agency Accession DA 30 3398

Hydrogen induced cracks have been identified in the weld metal of cast armor steel weldments fabricated with austenitic electrodes. Cracks propagated through a well defined band of martensite located between the fusion boundary and the composite region of the weld metal. Martensite band formation was found to result from the combined effects of vigorous hydrodynamic forces, especially in large molten weld pools, and the interdusion of alloying elements in that system formed between the base metal and the weld metal. Methods of controlling this form of cracking include limiting base metal dilution, minimizing the concentration of available hydrogen in the weld metal, and atmosphere, or the selection of more suitable ferritic filler alloys.

U.S. Army Materials Technology Laboratory
Watertown, Massachusetts 02172-0001
HYDROGEN INDUCED CRACKS IN ARMOR STEEL WELDMENTS
FABRICATED WITH AUSTENITIC FILLER ALLOYS -
William S. Ricci

AD

UNCLASSIFIED
UNLIMITED DISTRIBUTION

Key Words

Welding
Armor
Stainless steel

Technical Report MTL TR 87-50, September 1987, 11 pp -
illus-table, D/A Project 11263102D0077,
Agency Accession DA 30 3398

Hydrogen induced cracks have been identified in the weld metal of cast armor steel weldments fabricated with austenitic electrodes. Cracks propagated through a well defined band of martensite located between the fusion boundary and the composite region of the weld metal. Martensite band formation was found to result from the combined effects of vigorous hydrodynamic forces, especially in large molten weld pools, and the interdusion of alloying elements in that system formed between the base metal and the weld metal. Methods of controlling this form of cracking include limiting base metal dilution, minimizing the concentration of available hydrogen in the weld metal, and atmosphere, or the selection of more suitable ferritic filler alloys.

U.S. Army Materials Technology Laboratory
Watertown, Massachusetts 02172-0001
HYDROGEN INDUCED CRACKS IN ARMOR STEEL WELDMENTS
FABRICATED WITH AUSTENITIC FILLER ALLOYS -
William S. Ricci

AD

UNCLASSIFIED
UNLIMITED DISTRIBUTION

Key Words

Welding
Armor
Stainless steel

Technical Report MTL TR 87-50, September 1987, 11 pp -
illus-table, D/A Project 11263102D0077,
Agency Accession DA 30 3398

Hydrogen induced cracks have been identified in the weld metal of cast armor steel weldments fabricated with austenitic electrodes. Cracks propagated through a well defined band of martensite located between the fusion boundary and the composite region of the weld metal. Martensite band formation was found to result from the combined effects of vigorous hydrodynamic forces, especially in large molten weld pools, and the interdusion of alloying elements in that system formed between the base metal and the weld metal. Methods of controlling this form of cracking include limiting base metal dilution, minimizing the concentration of available hydrogen in the weld metal, and atmosphere, or the selection of more suitable ferritic filler alloys.